

Date: Monday, 6/5/2006 7:30:01 AM
 User: Kim Johnston

Process Sheet

Customer	: CU-DAR001 Dart Helicopters Services	Drawing Name	: 206 L HIGH GEAR SKIDTUBE
Job Number	: 27336A		
Estimate Number	: 10539		
P.O. Number	: N/A	Part Number	: D206642341
This Issue	: 6/5/2006	S.O. No.	: N/A
Prsht Rev.	: NC	Drawing Number	: D2650 REV E
First Issue	: N/A	Project Number	: N/A
Previous Run	: 27335A	Drawing Revision	: E
		Material	: N/A
Written By	: <u>See Comment Below</u>	Due Date	: 6/30/2006
Checked & Approved By	: <u>06.06.05</u>	Qty:	1 Um: Each
Comment	: Est Rev: H 05.10.11 Added D3429-1 per CHG004 KJ/CP/JLM		

Additional Product

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

1.0	DC	DOCUMENT CONTROL
-----	----	------------------



Comment: DOCUMENT CONTROL

Photocopy bluefile and create labels per PPP D206-642-341 CHG002

KJ 06.06.19

2.0	D2620	Bent 206 Skidtube
-----	-------	-------------------



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part Number	Description	Batch
1 D2620	Bent Tube 3" OD	BE 06.06.27

3.0	D2647	Cap
-----	-------	-----



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part Number	Description	Batch
1 D2647	Fwd Cap	BE 06.06.27

4.0	LANDING GEAR 1	LANDING GEAR RESOURCE 1
-----	----------------	-------------------------



Comment: LANDING GEAR RESOURCE 1

- 1-Deburr Fwd edge of tube BE 06.06.27
- 2-Remove ridge on inside of Fwd edge of tube as per Dwg D2650 BE 06.06.27
- 3-Weld Fwd Cap as per Dwg D2650. Use aluminum rod. Grind D2647 to fit as required. BE 06.06.27
A/R Aluminum Rod m100660/m18839
- 4-Grind weld flush to cap on top surface only. BE 06.06.28

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Mfg / Design Mgr	Approval QC Inspector

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Design Mgr	Approval QC Inspector
			Initial Design Mgr	Action Description Design Mgr	Sign & Date			

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

NOTE: Date & initial all entries

QA: N/C Closed: _____ Date: _____

Date: Monday, 6/5/2006 7:30:02 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206 L HIGH GEAR SKIDTUBE

Job Number: 27336A

Part Number: D206642341

Job Number:



Seq. #:

Machine Or Operation:

Description :

5-Cut aft end to length as per dwg D2650

6-Drill pilot holes using drill Jig DT8168A (A, & B). Open to Ø0.312"

7-Drill holes for wearplates using DT 8028-5. Open to Ø 0.297".

8-Open Aft Cap Hole using #6 Drill Bit

9-Open holes for Tow Ring to Ø0.625" as per Dwg D2650, D2650-5 Drilling Detail

10-Remove inner indexing ridge on aft end of skidtube as per Dwg D2650

11-Deburr and Blow out all chips from inside the tube

BE 06-06-28

5.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Chemical Conversion Coat as per QSI 005 4.1

PT 06-07-04

6.0

D26545

206 I Beam (Web)



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 D2654-5 Web 321093 PT 06-07-04

7.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Open holes to finished size as per Dwg D2650, D2650-5 Drilling Detail (without cutting fluid)

2-Countersink crossbolt spacer holes as per Dwg D2650(without cutting fluid)

3-Deburr. Blow out chips. Grind alodine off around crossbolt spacer.

4-Bond D2654-5 web in place as per QSI 015 Ensure holes line up Allow 12 Hrs. cure time before cutting

Start Date: 060204 Time: 11:15

Finish Date: 060304 Time: 7:00 am

A/R Sikaflex-291 1101193

Sikaflex expiry date: 061507

PT 06-07-04

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Mfg / Design Mgr	Approval QC Inspector

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Design Mgr	Approval QC Inspector
			Initial Design Mgr	Action Description Design Mgr	Sign & Date			

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

NOTE: Date & initial all entries

QA: N/C Closed: _____ Date: _____

Date: Monday, 6/5/2006 7:30:02 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206 L HIGH GEAR SKIDTUBE

Job Number: 27336A

Part Number: D206642341

Job Number:



Seq. #:

Machine Or Operation:

Description :

8.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

DP 6-7-6

9.0

D2649

Crossbolt Spacer



Comment: Qty.: 17.0000 Each(s)/Unit Total : 17.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

17 D2649

Crossbolt spacer

B23864 BE 6-7-10

10.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Insert cross bolt spacers D2649. Weld as per QSI 004 and Dwg D2650. Remember to back drill each hole to 0.25" before welding the other side. Use aluminum rod.

A/R Aluminum Rod

m18839 BE 6-7-10

2-Grind welds flush as per Dwg D2650. Masking Tape access to inside of the Skidtube

DP 6-7-11

3-Counterbore 5/16" x 0.750" deep as per Dwg D2650Deburr

DP 6-7-11

11.0

D2680041

Nut Plate



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

1 D2680-041

Nut Plate

B24203

DP 6-7-11

12.0

CCR264SS33

Cherry Rivet



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

2 CCR264SS3-3

Rivets

m12997

DP 6-7-11

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Mfg / Design Mgr	Approval QC Inspector

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Design Mgr	Approval QC Inspector
			Initial Design Mgr	Action Description Design Mgr	Sign & Date			

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

NOTE: Date & initial all entries

QA: N/C Closed: _____ Date: _____

Date: Monday, 6/3/2006 7:30:02 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206 L HIGH GEAR SKIDTUBE

Job Number: 27336A

Part Number: D206642341

Job Number:



Seq. #:

Machine Or Operation:

Description :

13.0

M7885343

Rivet



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part Number

Description Batch

2 M7885/3-4-3

Rivets

M19099 DP 6-7-11

14.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Install D2680-041 Nut Plate as per Dwg D2650

DP 6-7-11

15.0

QC5/9

WELD INSPECTION



Comment: WELD INSPECTION

*Ad 07-12 ①
PD 06-07-13*

16.0

POWDER COATING

POWDER COATING



Comment: POWDER COATING

Powder Coat White (Ref. 4.3.5.1) as per QSI 005 4.3

Make sure Nut Plate Thread protected use paint screw

*SC 06/07/19 ①
DL*

17.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

a.m 06-07-20 ①

18.0

D26483

Wearpad



Comment: Qty.: 6.0000 Each(s)/Unit Total : 6.0000 Each(s)

Pick:

Qty Part Number

Description Batch

6 D2648-3

Wearpad

B25904

19.0

D265611

Wearplate



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description Batch

1 D2656-11

Wearshoe

B21095

DL 06/07/22 ①

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Mfg / Design Mgr	Approval QC Inspector

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Design Mgr	Approval QC Inspector
			Initial Design Mgr	Action Description Design Mgr	Sign & Date			

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

NOTE: Date & initial all entries

QA: N/C Closed: _____ Date: _____

Date: Monday, 6/5/2006 7:30:02 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206 L HIGH GEAR SKIDTUBE

Job Number: 27336A

Part Number: D206642341

Job Number:



Seq. #:

Machine Or Operation:

Description :

20.0

D265623

Wearplate



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description Batch

1 D2656-23

Wearshoe

B24846

21.0

D265635

Wearplate



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description Batch

1 D2656-35

Wearshoe

B25330

22.0

D34291



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description Batch

1 D3429-1

Wearpad

B24417

23.0

ALS41032130

Insert



Comment: Qty.: 54.0000 Each(s)/Unit Total : 54.0000 Each(s)

Pick:

Qty Part Number

Description Batch

54 ALS41032-130

Inserts

M19393

or (see QSI 017)

24.0

AN960JD10L

Washer



Comment: Qty.: 54.0000 Each(s)/Unit Total : 54.0000 Each(s)

Pick:

Qty Part Number

Description Batch

54 AN960JD10L

Washer

M101291

PL 06/02/22 (1)

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Mfg / Design Mgr	Approval QC Inspector

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Design Mgr	Approval QC Inspector
			Initial Design Mgr	Action Description Design Mgr	Sign & Date			

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

NOTE: Date & initial all entries

QA: N/C Closed: _____ Date: _____

Date: Monday, 6/5/2006 7:30:02 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206 L HIGH GEAR SKIDTUBE

Job Number: 27336A

Part Number: D206642341

Job Number:



Seq. #:

Machine Or Operation:

Description :

25.0

MS27039108

Screw



Comment: Qty.: 54.0000 Each(s)/Unit Total : 54.0000 Each(s)

Pick:

Qty Part Number

Description Batch

54 MS27039-1-08

Screw

M19551

26.0

D26511

Plug



Comment: Qty.: 14.0000 Each(s)/Unit Total : 14.0000 Each(s)

Pick:

Qty Part Number

Description Batch

14 D2651-1

Plugs

B25865

27.0

D26513

O-Ring



Comment: Qty.: 14.0000 Each(s)/Unit Total : 14.0000 Each(s)

Pick:

Qty Part Number

Description Batch

14 D2651-3

O-Rings

B25978

28.0

AN960JD416

Washer



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description Batch

1 AN960JD416

Washer

M11151

29.0

MS27039406

Screw



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description Batch

1 MS27039-4-06

Screw

M6874

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Mfg / Design Mgr	Approval QC Inspector

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Design Mgr	Approval QC Inspector
			Initial Design Mgr	Action Description Design Mgr	Sign & Date			

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

NOTE: Date & initial all entries

QA: N/C Closed: _____ Date: _____

Date: Monday, 6/5/2006 7:30:02 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206 L HIGH GEAR SKIDTUBE

Job Number: 27336A

Part Number: D206642341

Job Number:



Seq. #:

Machine Or Operation:

Description :

30.0

D2646

Aft Cap



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description Batch

1 D2646

Aft Cap B25381

31.0

AN960JD10L

Washer



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part Number

Description Batch

2 AN960JD10L

Washer M101291

32.0

MS27039108

Screw



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part Number

Description Batch

2 MS27039-1-08

Screw M19551

DL 06/02/22 (1)

33.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

1-Install inserts & wearpads as per dwg D2922. Use a drop of Sikaflex inside insert holes before installing wearpad/wearplate.

A/R Sikaflex-291

M101193

Sikaflex expiry date:

11/06

2-Install O-Rings D2651-3 on plugs D2651-1 with Petroleum Jelly and install plugs as per Dwg D2650. Clean excess adhesive

3-Install MS27039-4-06 Screw as per DEO 9153

4-Inspect for foreign object per QSI 024

5-Install D2646 Aft Cap and seal with SikaflexClean excess adhesive

A/R Sikaflex-291

M101193

Sikaflex expiry date:

11/06

6-Wing Walk as per Dwg D2650-5 and QSI 005 4.4

Batch: M101667

FC 06 07 24 (1)

DL 06/07/23 (1)

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Mfg / Design Mgr	Approval QC Inspector

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Design Mgr	Approval QC Inspector
			Initial Design Mgr	Action Description Design Mgr	Sign & Date			

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes ☒ No ☐ DQA:  Date: 06/08/01

NOTE: Date & initial all entries

QA: N/C Closed: _____ Date: _____

Date: Monday, 6/5/2006 7:30:03 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206 L HIGH GEAR SKIDTUBE

Job Number: 27336A

Part Number: D206642341

Job Number:



Seq. #:

Machine Or Operation:

Description :

34.0

QC3/5

INSPECT WORK/WING WALK



Comment: INSPECT WORK/WING WALK

06.07.25

35.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Identify and Stock

Location: _____

N/A

36.0

DC

DOCUMENT CONTROL



Comment: DOCUMENT CONTROL

Inspection Level 21

DD 06/08/01

Job Completion



06.08.01

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Mfg / Design Mgr	Approval QC Inspector

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Design Mgr	Approval QC Inspector
			Initial Design Mgr	Action Description Design Mgr	Sign & Date			

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

NOTE: Date & initial all entries

QA: N/C Closed: _____ Date: _____



DESIGN <i>14P</i>	DRAWN BY <i>14P</i>	DART AEROSPACE USA, INC. PORT HADLOCK, WA	
CHECKED <i>PH</i>	APPROVED <i>PH</i>	DRAWING NO. D2650	REV. E SHEET 1 OF 5
DATE 06.03.30		TITLE 206/407 SKIDTUBE ASSEMBLIES	SCALE NTS
A	97.03.25	NEW ISSUE	
B	97.06.26	AS MANUFACTURED CHANGES	
C	97.10.29	CHANGE HOLE PATTERN AND FRONT END	
D	04.05.17	REDRAW; INCORP. DE09136/9153/9163 MOD GROUND HNDLNG ON D2650-1/-3	
E	06.03.30	RMV C'BORE, CHG DRILL, ADD CHAMFER	

RELEASED
16 04 17 *PH*

Qty -1	Qty -3	Qty -5	Qty -7	Part Number	Description
X				D2650-1	SKIDTUBE ASSEMBLY
	X			D2650-3	SKIDTUBE ASSEMBLY
		X		D2650-5	SKIDTUBE ASSEMBLY
			X	D2650-7	SKIDTUBE ASSEMBLY
1	1	1	1	D2600-1-160	EXTRUSION
1				D2654-1	WEB
	1			D2654-3	WEB
		1		D2654-5	WEB
			1	D2654-7	WEB
1	1	1	1	D2646	AFT CAP
1	1	1	1	D2647	CAP
16	17	19	23	D2649	CROSS BOLT SPACER
16	18	14	22	D2651-1	PLUG
16	18	14	22	D2651-3	O-RING
1	1	1	1	D2680-041	NUT PLATE
2	2			D3286-1	DOUBLER
2	2			D3286-3	STUD
42	44	54	60	ALS7-1032-130	INSERT (or AKS4-1032-130, ALS4-1032-130, ALS7-1032-130)
2	2	2	2	AN960JD10L	WASHER
2	2	2	2	CCR264SS3-3	RIVET
2	2	2	2	CR3212-4-03	RIVET
2	2	2	2	MS27039-1-08	SCREW
1	1	1	1	MS27039-4-06	SCREW
1	1	1	1	AN960JD416	WASHER
52	52			CR3212-4-04	RIVET


NOTES



- 1) WELD PER DART QSI 004
- 2) DAMAGE TOLERANCE ON FWD BEND:
THERE SHOULD BE NO VISIBLE WRINKLES IN THE BEND FROM THE GROUND TO A HEIGHT OF 5 INCHES ABOVE THE GROUND. IT IS ACCEPTABLE TO POLISH OUT GOUGES UP TO 0.020 DEEP IN THE BENT PORTION OF THE TUBE. A MAXIMUM REDUCTION IN DIAMETER OF 0.150" IS ACCEPTABLE IN THE BENT PORTION OF THE TUBE.
- 3) BOND WEB INTO OUTER TUBE WITH SIKAFLEX-241/-291 ADHESIVE PER DART QSI 015
- 4) INSERT D2651-1 PLUG C/W D2651-3 O-RING IN HOLES MARKED 'P' (BOTH SIDES OF TUBE)
- 5) FINISH: -CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
-POWDER COAT WHITE (4.3.5.1) PER DART QSI 005 4.3
-BLACK ANTI-SKID PAINT AS INDICATED TO 0.5 ABOVE LOCATION RIDGE PER DART QSI 005 4.4
- 6) DRILL Ø0.297 FOR ALS7-1032-130 INSERTS USING TEMPLATE DT8056-1 ON -1 TUBE, DT8056-3 ON -3 TUBE, DT8056-5 ON -5 TUBE, AND DT8056-7 ON -7 TUBE. INSTALL INSERTS AFTER FINISH.
- 7) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED

SHOP COPY
RETURN TO
ENGINEERING
CONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 27336A

Copyright © 1997 by DART AEROSPACE USA, INC.


THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

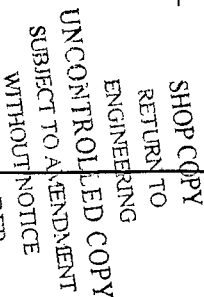

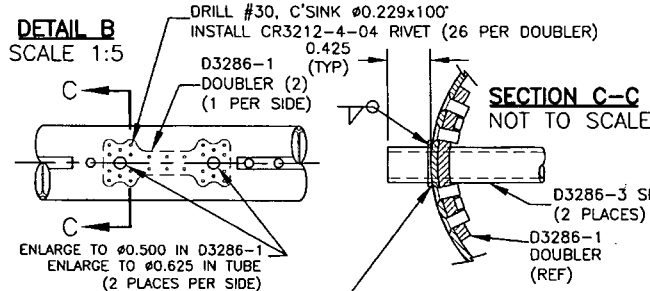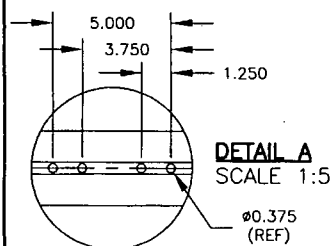

- TO INSTALL D3286-1/-3:
1. GRIND OFF FLANGE IN AREA SHOWN, FLUSH WITH ROUND TUBE
 2. LOCATE & DRILL D3286-1 DOUBLER USING DT3286-1T1
 3. ENLARGE HOLES IN D3286-1 TO $\phi 0.500$
 4. ENLARGE HOLES IN TUBE TO $\phi 0.625$ AND CHAMFER HOLE $0.030 \times 45^\circ$
 5. RIVET D3286-1 TO TUBE
 6. INSERT D3286-3 SPACER
 7. WELD IN PLACE AND GRIND FLUSH



SECTION C-C
NOT TO SCALE

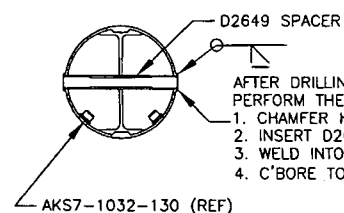

- AFTER DRILLING AND BENDING ASSEMBLY PERFORM THE FOLLOWING FOR $\phi 0.375$ HOLES ONLY:
1. CHAMFER HOLE $0.030 \times 45^\circ$
 2. INSERT D2649 SPACER
 3. WELD INTO PLACE AND GRIND FLUSH
 4. C'BORE TO $\phi 0.313 \times 0.75$ DEEP

RELEASED


26.04.17

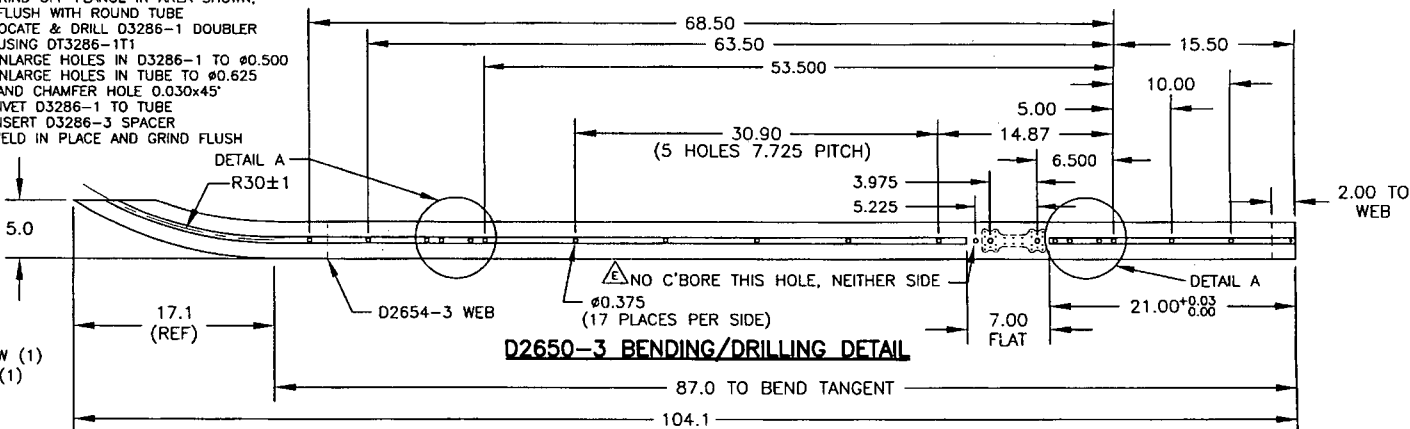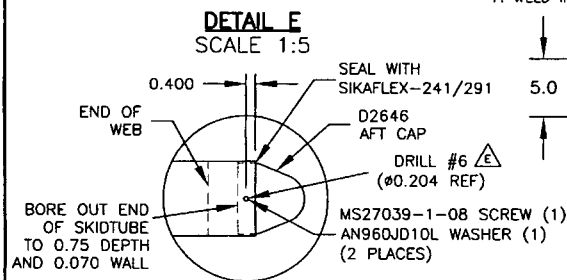

DETAIL F (NOT TO SCALE)


1. CUT TUBE LEVEL
2. REMOVE RIDGE ON FWD SIDE
3. LOCATE D2647 (TRIM AS NECESSARY)
4. WELD D2647 IN PLACE PER DART QSI 004
5. GRIND FLUSH
6. RIVET D2680-041 NUT PLATE IN PLACE

 NOTE: MASK THREADS IN D2680-041 PRIOR TO FINISH



REMOVE RIDGE ON INSIDE OF SKIDTUBE LEAVE 0.070 MIN.

- MS27039-1-08 SCREW (1)
AN960JD10L WASHER (1)
CCR264SS3-3 RIVET (2 PLACES)
CR3212-4-03 RIVET (2 PLACES)
D2680-041 NUTPLATE (1)
D2647 CAP (1)

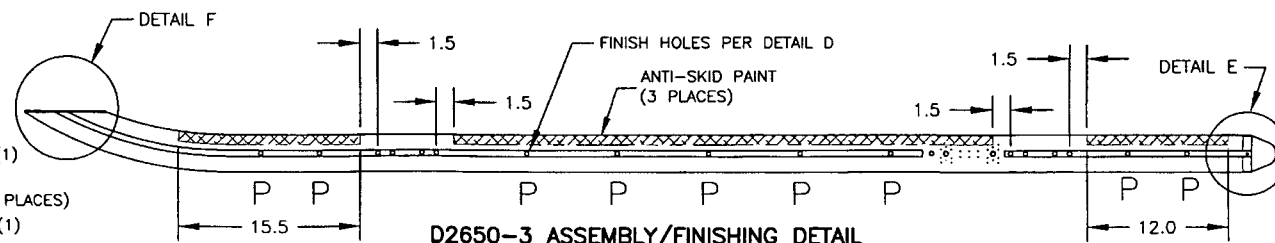

NO. 27536 A
WORK ORDER
SUBJECT TO AMENDMENT
WITHOUT NOTICE
UNCONTROLLED COPY
ENGINEERING
RETURN TO
SHOP COPY

Copyright © 2004 by DART Aerospace USA, Inc.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

DESIGN

UP

CHECKED

PH

DATE

06.03.30

DRAWN BY

UP

APPROVED

AL

TITLE

SKIDTUBE

DART DART AEROSPACE USA, INC.
PORT HADLOCK, WA

DRAWING NO.




D2650

SCALE

1:10

REV. E


SHEET 3 OF 5

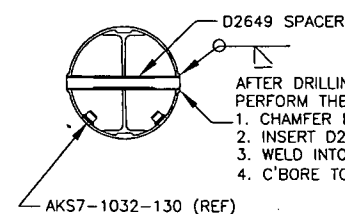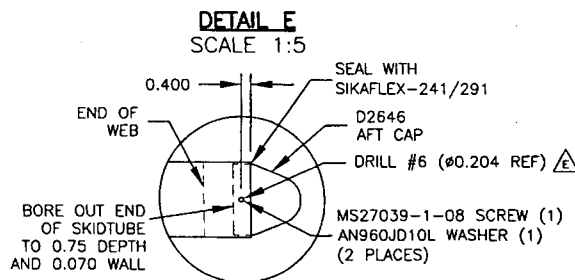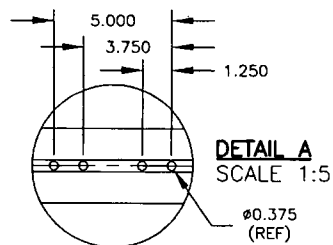


DETAIL D
FOR Ø0.375 HOLES ONLY

- AFTER DRILLING AND BENDING ASSEMBLY
PERFORM THE FOLLOWING FOR Ø0.375 HOLES ONLY:
1. CHAMFER HOLE 0.030 X 45°
 2. INSERT D2649 SPACER
 3. WELD INTO PLACE AND GRIND FLUSH
 4. C'BORE TO Ø0.313 X 0.75 DEEP

RELEASED

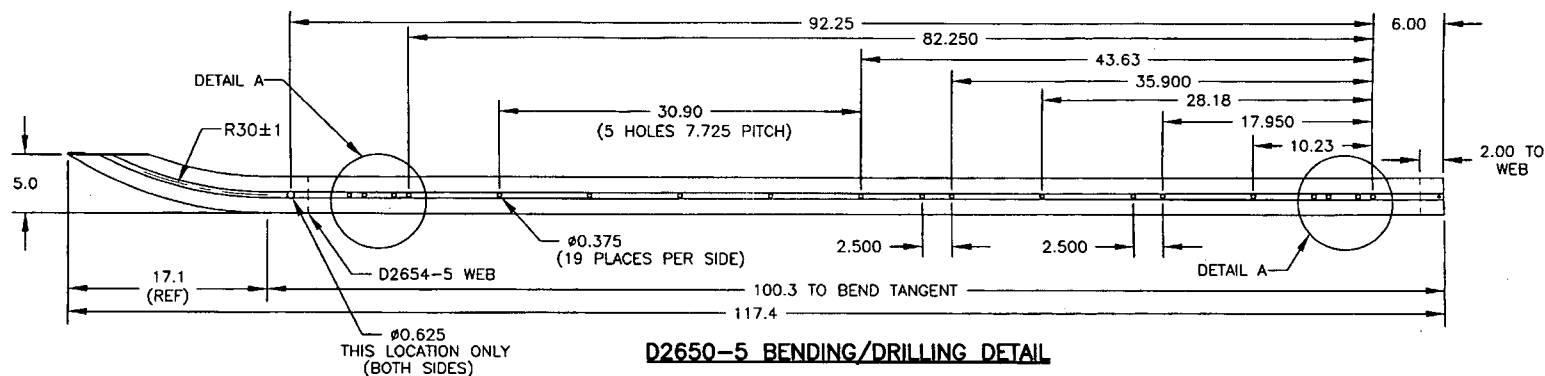

D2650-5 BENDING/DRILLING DETAIL

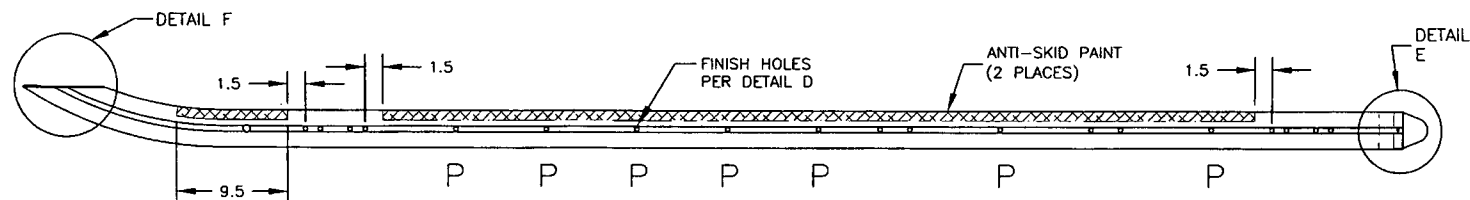


D2650-5 ASSEMBLY/FINISHING DETAIL

DETAIL F (NOT TO SCALE)

1. CUT TUBE LEVEL
2. REMOVE RIDGE ON FWD SIDE
3. LOCATE D2647 (TRIM AS NECESSARY)
4. WELD D2647 IN PLACE PER DART QSI 004
5. GRIND FLUSH
6. RIVET D2680-041 NUT PLATE IN PLACE






 
NOTE: MASK THREADS IN D2680-041 PRIOR TO FINISH



REMOVE RIDGE ON INSIDE OF SKIDTUBE LEAVE 0.070 MIN.

NO. 21356A
WORK ORDER
UNCONTROLLED COPY
ENGINEERING
RETURN TO
SHOP COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE

COPYRIGHT © 2004 BY DART AEROSPACE USA, INC.		DESIGN	UP	DRAWN BY	UP	DART DART AEROSPACE USA, INC. PORT HADLOCK, WA	
CHECKED	PH	APPROVED	PH	DRAWING NO.	D2650	REV. E	SHEET 4 OF 5
DATE	06.03.30	TITLE	SKIDTUBE	SCALE	1:10		

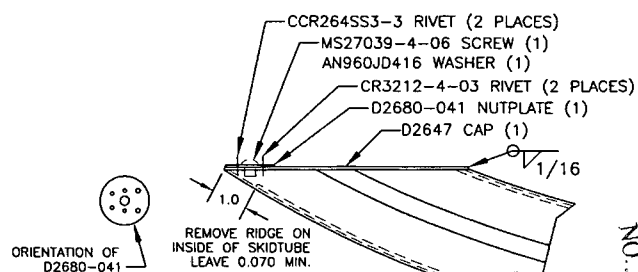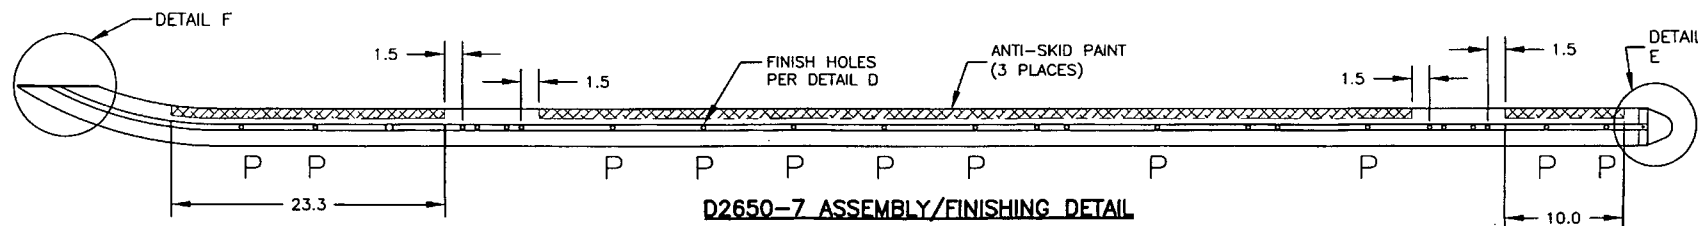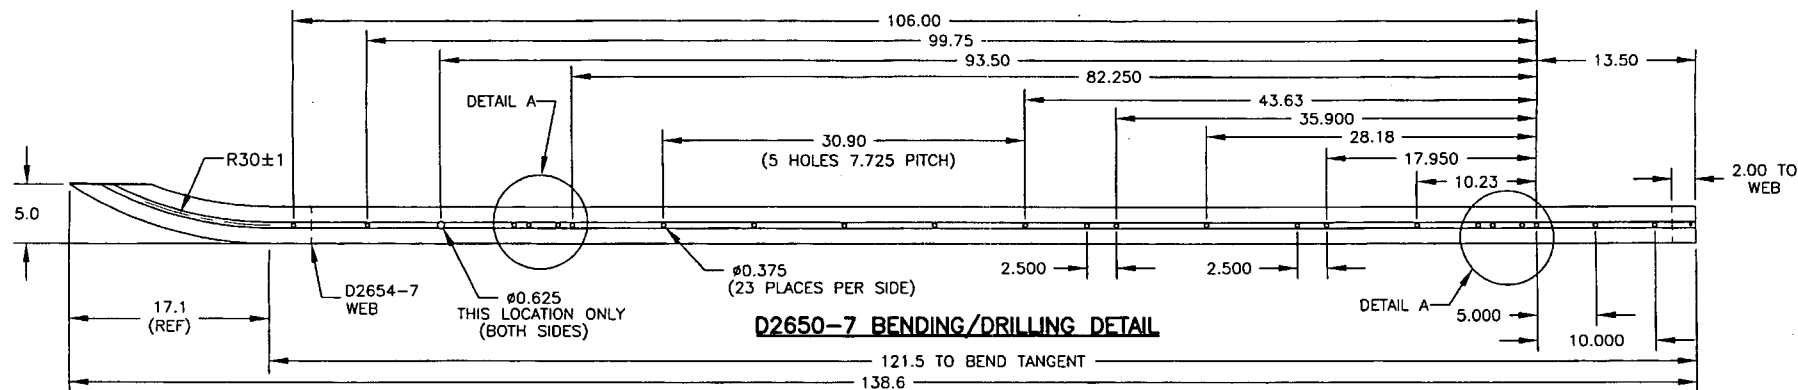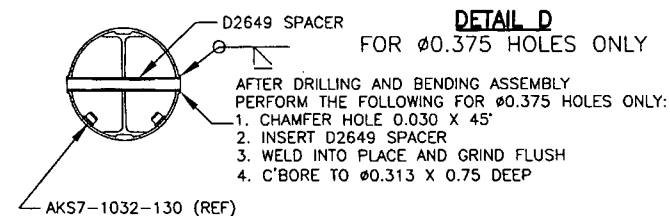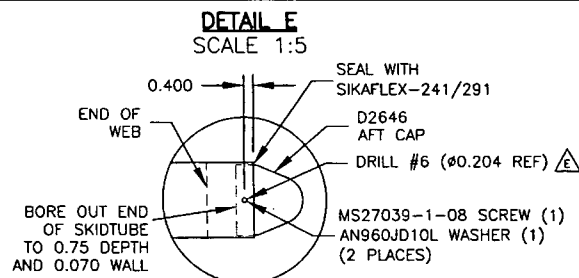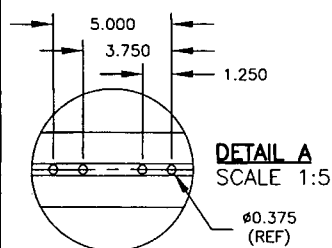

- DETAIL F (NOT TO SCALE)**
1. CUT TUBE LEVEL
 2. REMOVE RIDGE ON FWD SIDE
 3. LOCATE D2647 (TRIM AS NECESSARY)
 4. WELD D2647 IN PLACE PER DART QSI 004
 5. GRIND FLUSH
 6. RIVET D2680-041 NUT PLATE IN PLACE

NOTE: MASK THREADS IN D2680-041 PRIOR TO FINISH

NO. 27336A

WORK ORDER

WITHOUT NOTICE

CONTROLLED COPY

ENGINEERING

RETURN TO

SHOP COPY

COPYRIGHT © 2004 BY DART AEROSPACE USA, INC.		DESIGN	DRAWN BY	DART DART AEROSPACE USA, INC. PORT HADLOCK, WA
CHECKED	APPROVED	DATE	06.03.30	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.				REV. E
DRAWING NO. D2650				SHEET 5 OF 5
TITLE SKIDTUBE				SCALE 1:10

RELEASED

0.017